



SUB-COMMITTEE ON DANGEROUS
GOODS, SOLID CARGOES AND
CONTAINERS
13th session
Agenda item 6

DSC 13/INF.7
2 July 2008
ENGLISH ONLY

CASUALTY AND INCIDENT REPORTS AND ANALYSIS

Toxic off-gassing of carbon monoxide and oxygen depletion during ocean transportation of pulp wood, wood chips and wood pellets

Submitted by Sweden

SUMMARY

Executive summary: This paper presents a study about toxic off-gassing of carbon monoxide and oxygen depletion during ocean transportation of pulp wood, wood chips and wood pellets. The study, which is in two parts – wood pellets and pulp wood respective wood chips – is made by Department of Occupational and Environmental Medicine Sundsvall Hospital, Sweden.

Strategic direction: 5.2

High-level action: 5.2.3

Planned output: 5.2.3.1

Action to be taken: Paragraph 3

Related documents: DSC 13/4/3 and DSC 13/INF.6

Introduction

1 The first part of the study was initiated after a fatal accident on board the vessel **Saga Spray** (DSC 13/INF.6) and is attached as “Hazardous off-gassing of carbon monoxide and oxygen depletion during ocean transportation of wood pellets”.

2 Another fatal accident in May 2007, causing the death of two people during discharge of pulp wood in the Port of Timrå, Sweden, initiated the second part of the study and is attached as “Toxic off-gassing and oxygen depletion during ocean transportation of pulp wood and wood chips”.

For reasons of economy, this document is printed in a limited number. Delegates are kindly asked to bring their copies to meetings and not to request additional copies.

Action requested of the Sub-Committee

- 3 The Sub-Committee is invited to note the information provided.

Hazardous Off-Gassing of Carbon Monoxide and Oxygen Depletion during Ocean Transportation of Wood Pellets

URBAN SVEDBERG^{1*}, JERKER SAMUELSSON² and STAFFAN MELIN³

¹Department of Occupational and Environmental Medicine, Sundsvall Hospital, Sundsvall, Sweden;

²Department of Radio and Space Science, Chalmers University of Technology, Gothenburg, Sweden;

³Department of Chemical and Biological Engineering, University of British Columbia, BC, Canada

Received 12 December 2007; in final form 22 February 2008; published online 7 April 2008

Five ocean vessels were investigated for the characterization and quantification of gaseous compounds emitted during ocean transportation of wood pellets in closed cargo hatches from Canada to Sweden. The study was initiated after a fatal accident with several injured during discharge in Sweden. The objective with the investigation was to better understand the off-gassing and issues related to workers' exposure. Air sampling was done during transport and immediately before discharge in the undisturbed headspace air above the wood pellets and in the staircase adjacent to each hatch. The samples were analyzed with Fourier transform infrared spectroscopy and direct reading instruments. The following compounds and ranges were detected in samples from the five ships: carbon monoxide (CO) 1460–14650 ppm, carbon dioxide (CO₂) 2960–21570 ppm, methane 79.9–956 ppm, butane equivalents 63–842 ppm, ethylene 2–21.2 ppm, propylene 5.3–36 ppm, ethane 0–25 ppm and aldehydes 2.3–35 ppm. The oxygen levels were between 0.8 and 16.9%. The concentrations in the staircases were almost as high as in the cargo hatches, indicating a fairly free passage of air between the two spaces. A potentially dangerous atmosphere was reached within a week from loading. The conclusions are that ocean transportation of wood pellets in confined spaces may produce an oxygen deficient atmosphere and lethal levels of CO which may leak into adjacent access spaces. The dangerous combination of extremely high levels of CO and reduced oxygen produces a fast-acting toxic combination. Measurement of CO in combination with oxygen is essential prior to entry in spaces having air communication with cargo hatches of wood pellets. Forced ventilation of staircases prior to entry is necessary. Redesign, locking and labeling of access doors and the establishment of rigorous entry procedures and training of onboard crew as well as personnel boarding ocean vessels are also important.

Keywords: confined space; emissions; exposure measurements; oxygen deficiency; seamen

INTRODUCTION

The use of wood pellets as an energy source for domestic, municipal and industrial use has increased dramatically during the last few years. A direct consequence of this is that ocean transportation of the commodity in large bulk has become commonplace, and in 2007, ~40% of the total global wood pellet production of 9 million tons underwent shorter or longer ocean transportation (Melin, 2007). The majority of wood pellets are produced by milling

wood chips, bark, planer shavings or sawdust into a fine powder, which after drying is compressed into pellets of 6- or 8-mm diameter. The dense wood pellet has moisture content of 10% or less. The pellets described in this paper were made from sawdust and planer shavings from Lodgepole pine (*Pinus Contorta*).

The risks associated with the transportation of seemingly harmless cargo such as wood and wood products, including wood pellets, are neither well-known nor properly understood. This study was initiated after a fatal accident onboard a vessel in the Port of Helsingborg, Sweden, in November 2006, which occurred while the vessel was discharging

*Author to whom correspondence should be addressed.

Tel: +46-(0)60-18 15 52; fax: +46-(0)60-18 19 80;

e-mail: urban.svedberg@lvn.se

wood pellets from British Columbia, Canada. One seaman was killed, a stevedore was seriously injured and several rescue workers were slightly injured after entering an unventilated stairway next to a cargo hold. The dead seaman was removed after ~ 15 min. The injured stevedore lost consciousness and was pulseless when removed from the contaminated atmosphere after ~ 10 min. He was treated with hyperbaric oxygen but his condition deteriorated with the onset of neurological symptoms that later proved to be caused by a cerebral vascular lesion which eventually left him bound to a wheel chair. It was first believed that the workers were affected by lack of oxygen, but on arrival at the hospital, it was concluded that they had also been exposed to carbon monoxide (CO).

The vessels used for these 7- to 9-week ocean voyages are classified as box-shaped dry-cargo vessels and used for transport of pulp, lumber, wood pellets etc. in the Pacific as well as in the Atlantic Oceans. Wood pellets have been transported between British Columbia and European ports since 1997. In 2002, one stevedore died and several other workers were injured in the Port of Rotterdam under similar circumstances, but to our knowledge, that accident has not been reported in the scientific literature, nor has there been any systematic quantification of gas emissions during other shipments of wood pellets.

A typical vessel of this type has up to 10 cargo holds, each of which can hold ~ 3000 tons of wood pellets. Adjacent to the each hold is an access stairway (Australian ladder type) leading from the outside deck down to the bottom of the vessel, see Fig. 1. This ladder is entered through a deck-access door. The stairway has three landings, each equipped with a door in to the cargo hold. These doors are closed

and sometimes taped during the voyage. Wood pellets must at all times be protected from water and the hatch covers (pontoon type) and the stairway access doors on deck are closed during the voyage. The doors are labeled on the outside and sometimes on the inside with warnings of a possible oxygen-deficient atmosphere, but there is no reference to the potential presence of hazardous gases.

At the time of the fatal accident in the Port of Helsingborg, no air measurements had been taken prior to entering the stairway, contrary to the usual routine of making an oxygen check. The deck-access door had been left open for ~ 8 h on the previous day while another cargo hold was discharged. However, due to the risk of rain, all doors were closed after the shift ended at 22:00 and opened again at 05:45 the next morning, the day of the accident. The accident occurred around 08:00.

It has previously been reported that CO and other one-carbon compounds, such as methanol, formic acid and formaldehyde, are emitted from wood pellets during storage in warehouses (Svedberg *et al.*, 2004). The authors also reported emissions of aldehydes, predominantly hexanal and pentanal, which they suggested were formed by a radical-induced oxidative degradation of natural lipids, particularly the polyunsaturated linoleic acid. The biochemical mechanism by which the one-carbon compounds were formed was not clear but again the oxidation of fatty acids and other components in the wood seemed likely. The oxidative processes occurred below room temperature but were accelerated by elevated temperature.

The immediate objective of the present study was to investigate and describe the composition and concentrations of gaseous compounds in the stairways and cargo holds of vessels carrying wood pellets, in

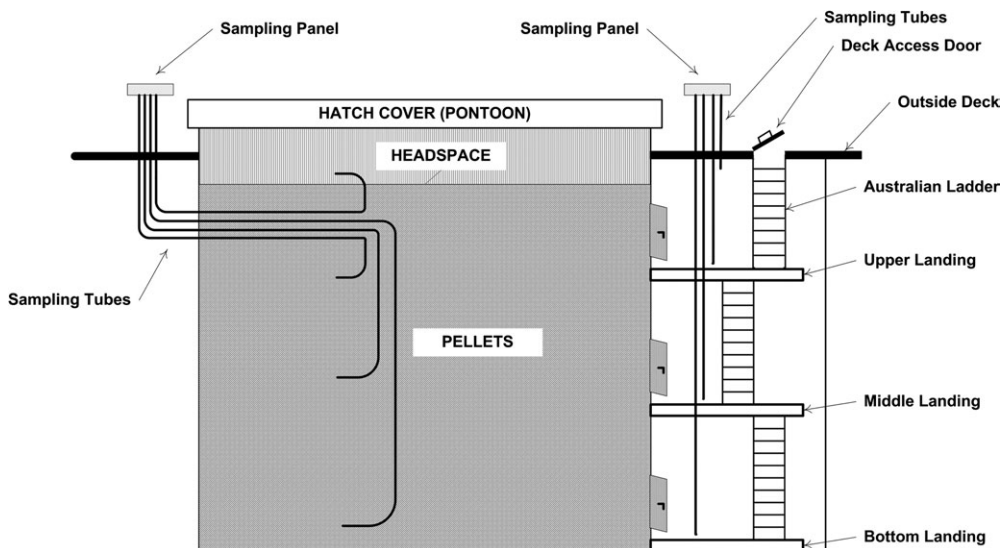


Fig. 1. Schematics of sampling points in the cargo hold and stairway on Vessel #4.

order to better understand the off-gassing and issues related to the exposure of the workers.

METHODS

Five different vessels carrying wood pellets from British Columbia were investigated after arrival in the Port of Helsingborg, Sweden. Before the hatch covers were removed, air samples were collected through a small side door leading to the headspace air above the pellet bed. Air samples were collected 2 days after the accident from an undisturbed cargo hold from the vessel on which the fatal accident took place (Vessel #1). On Vessel #3 and #5, samples were also collected in the undisturbed air of the respective stairways by lowering sampling tubes through a slightly opened access door. The samples were collected by pumping the air into Tedlar sample bags which were analyzed immediately on the dockside in a mobile laboratory installed in a minivan or within the next few days in one of our laboratories in Sweden. Vessel #4 was sampled by pumping the air through long nylon tubing directly to the analytical cell in the mobile laboratory. All samples were analyzed using Fourier transform infrared spectroscopy (FTIR) instruments (Bomem MB-series, Bomem, Quebec, Canada), equipped with gas cells (White type) and nitrogen-cooled mercury-cadmium-telluride detectors. The FTIR technique detects gaseous compounds in the 2.5- to 11.5- μm infrared wavelength region. The concentrations of CO, carbon dioxide (CO₂) and methane (CH₄) in the spectra were analyzed by fitting a set of calibration spectra based on the Hitran2000 spectral database (Griffith, 1996; Rothman *et al.*, 2003). Alkanes (C_nH_{2n+2}), ethylene, propylene, methanol and propanal concentrations were retrieved using the PNNL database (Sharpe *et al.*, 2004). The uncertainty in the concentration retrievals is made up of the absolute uncertainty in the absorption cross sections in the databases, and the uncertainty in the fitting procedure itself. For CO, CO₂, CH₄, ethylene and alkanes (C₃ and higher), the overall uncertainty was 5%, for propylene 6% and 8% for methanol. Ethane and propanal concentrations were associated with a 15% uncertainty in the present study. Alkanes were retrieved in the 3.2- to 3.7- μm wavelength region, where the absorption is due to the C-H bond. The specificity among the different alkanes are thus somewhat limited, but the total alkane mass can be retrieved well, fitting a set of different alkanes. Propane and pentane were used in the fit, whereas the total alkane mass is presented as butane equivalents.

Upon discharge of the wood pellets, oxygen was measured using a direct-reading, hand-held instrument, RKI-GX-2001 (Riken Keiki Co. Ltd, Tokyo, Japan), with a galvanic cell sensor, calibrated with ambient air and 12% oxygen span gas.

In an attempt to describe the dynamics of the off-gassing during the voyage, a system of sampling points was installed in one cargo hold and the respective stairway prior to the loading of Vessel #4, schematically outlined in Fig. 1. Sampling could thus be carried out from two sample panels without opening the deck-access door and hatch cover. Measurement of CO and oxygen were taken three times a day by the vessel's crew during the ocean transport, using a gas meter, model ATX620 (Industrial Scientific, Oakdale, PA, USA), equipped with an electrochemical sensor and calibrated with zero-gas (20.9% O₂ and 79.1% N₂) and 100 ppm CO.

Oxygen depletion in a cargo hold is believed to be caused by several mechanisms. Corrosion consumes oxygen. Microbiological activity both consumes oxygen and produces CO₂. Oxygen may also dissolve in water. However, our belief is that the primary mechanisms for oxygen depletion in wood pellets are triggered by oxidative reactions with wood constituents.

Linoleic acid (CAS 60-33-3) is the predominant unsaturated fatty acid in wood and presumably also in wood pellets. It is difficult to buy the pure fatty acids present in wood in larger quantities, but they are readily available in mixture in commercial linseed oil. The major constituents of the linseed oil sold in Sweden are the unsaturated fatty acids linolenic acid (CAS 463-40-1) ~56%, oleic acid (CAS 112-80-1) ~18% and the above mentioned linoleic acid ~15.4%. To explore the hypothesis that oxidative degradation of fatty acids occurs and to identify gaseous emissions, a simple experiment was staged where the headspace air of common raw linseed oil was investigated. A sealed 1-l plastic bottle containing linseed oil was acquired from a paint shop. The bottle showed clear signs of deflation, indicating oxygen depletion in the headspace air. With an airtight syringe, a sample of headspace air was collected and analyzed, without dilution, in a 50-ml FTIR gas cell with a 1-m optical path (Axiom Analytical Inc., Irvine, CA, USA). The oxygen level in the bottle was measured with the hand-held instrument, RKI-GX-2001.

Hydrogen sulfide, (H₂S), is formed during anaerobic bacterial decomposition of the sulfurous material in organic matter. The FTIR method used in this project was not sensitive enough to measure hydrogen sulfide in levels <100 ppm. Screening measurements with H₂S monitors prior to this study indicated no H₂S in a cargo of wood pellets and it was therefore omitted from further evaluation unless its presence was indicated in the FTIR spectra.

RESULTS

The results from the measurements aboard the vessels and from the headspace of the linseed oil are

summarized in Table 1. Particularly notable are the high CO and CO₂ concentrations and the low oxygen levels. No indication of the presence of H₂S was seen. When the oxygen level from each vessel was plotted as function of the CO level, a high degree of correlation was obtained ($r^2 = 0.92$, see Fig. 2). Good correlation was also found between CO and butane equivalents ($r^2 = 0.93$) and CO₂ and propylene ($r^2 = 0.98$).

The aldehyde concentrations aboard the vessels were much lower than in previous findings in pellet warehouses. The qualitative analysis of headspace air above linseed oil revealed the presence of all the gas species found in the cargo holds and the reduction of the oxygen level was similar. The relative concentrations of aldehydes and ethane were higher.

The concentrations in the stairways were considerably lower than the levels found in the adjacent cargo holds, (Vessel #3 and #5). The stairway on Vessel #4 was sampled on four different levels, showing <1% stratification throughout the air column of the stairway.

The results from the measurements aboard the vessels of oxygen at the bottom of the stairway and in the headspace of the cargo hold on Vessel #4 are described in Fig. 3. A steady state with ~10% oxygen level was reached after ~3 weeks at sea. The CO level in the headspace of the hold reached 900 ppm after 7 days. The onboard CO instrumentation was found to be unreliable over 1000 ppm and further evaluation of this parameter was not possible until the FTIR analysis was available at the time the cargo was discharged in the Port of Helsingborg.

While Vessel #4 was discharging, the decay of CO at the bottom level of the stairway was monitored at 2.5-min intervals over a period of 2 h. The sample air was pumped to the mobile FTIR unit located alongside the vessel. Initially, the stairway deck-access door was closed and almost no decay could be seen. The door was then opened to simulate the usual self-ventilation procedure. Over the next 45 min, an exponential decay ($r^2 = 1.00$) was recorded corresponding to a ventilation rate of 0.23 air exchanges per hour. In order for the CO concentration at the bottom level of the stairway to reach an acceptable 8-h occupational exposure limit of 35 ppm according to Swedish standards, 26 h of ventilation would have been required.

DISCUSSION

The results from this study strongly suggest that immediate action needs to be taken in the maritime industry to prevent fatal accidents aboard cargo vessels. The extremely high CO concentrations and low oxygen levels found in the stairways are the most important findings from the point of view of workers' health. The combined toxic effect of CO and low oxygen content is the most likely explanation for the

rapid course of events leading to the tragic fatality and severe injury aboard Vessel # 1. The recorded CO₂ concentrations were occasionally above accepted short-term occupational exposure limits but are not considered life threatening by itself, although synergistic health effects with CO and O₂ may exist. The other chemicals identified were below or well below accepted exposure limits. The low aldehydes' levels compared to previous findings in warehouses can probably be explained by the fact that this particular emission decreases with time more rapidly than the others, and the several reloads of the pellets between production and final discharge.

Wood pellets undergo drying and heat treatment during processing, which may alter the chemical composition of the fatty acids in the wood. However, the results from the headspace analysis of linseed oil support the hypothesis that oxidative degradation of fatty acids occurs, and may explain at least part of the formation of gaseous compounds identified in headspace above wood pellets. The formation of CO explains only a fraction of the oxygen depletion. The majority of the oxygen is believed to be chemically bound in the oxidative degradation process of fatty acids and other organic materials present in wood. The recording of 0.8% oxygen in hold 2 on Vessel #5 shows that wood pellets may trap almost all available oxygen. One possible explanation for the fact that such low levels were not seen in every hold is that this particular hold may have been well sealed, with limited air communication to ambient air.

It is believed that the mechanisms behind oxygen depletion and the formation of gaseous compounds are quite complex and a deeper analysis is beyond the scope of this study. The high correlation found between several of the gaseous compounds may provide additional leads to an understanding of these mechanisms. In spite of its limitations, the information obtained from the experimental study with linseed oil provides important information, which may be useful in designing future studies of these processes.

CO is an odorless and colorless gas. CO binds to hemoglobin (Hb) forming a COHb complex that inhibits the ability of hemoglobin to bind oxygen. The level of CO saturation in the blood is measured as % COHb. Normal levels are 0.3–0.8% COHb, smokers have 3–8% COHb and most people who die from CO poisoning have >60% COHb (NAS/COT, 2005). The injured stevedore in the accident on Vessel #1 had 43.8% COHb when admitted to the hospital. For the working population, a maximum of 3.5% COHb at the end of shift and 20 ppm in end-exhaled air is suggested (ACGIH, 2007).

The occupational exposure limits for CO by inhalation in Sweden is 35 ppm for 8 h and 100 ppm for 15 min (Arbetskyddsstyrelsen, 2005). The current ACGIH's time weighted average is 25 ppm (ACGIH,

Table 1. Summary of all measurements from each vessel and headspace of linseed oil

	Vessel #1 Hold	Vessel #2 Hold	Vessel #3 Hold	Vessel #3 Stair	Vessel #4 Stair ^a	Vessel #5 Hold 2	Vessel #5 Stair 2	Vessel #5 Hold 4	Vessel # 5 Stair 4	Vessel #5 Hold 6	Vessel #5 Stair 6	Linseed Oil Headspace	
	November 2006	January 2007	February 2007	February 2007	March 2007	October 2007	October 2007	October 2007	October 2007	October 2007	October 2007		
CO	5850	6980	14 650	10 960	11 510	11 950	7710	7240	1460	8860	5300	1090	
CO ₂	9340	3240	7070	5450	5160	21 570	12 360	17 430	2960	18 820	8690	570	
Methane	614	216	632	468	204	956	589	388	79.9	454	246	40	
Ethylene	12.2	5.3	9.7	7.4	3.3	21.2	12.3	11.2	2.0	11.5	5.9	2.0	
Propylene	12.8	7.6	12.3	9.3	8.0	36	21.4	28.3	5.3	32.6	15.9	<0.5	
Methanol	2.2	0.2	0.5	0.4	0.7	4.5	1.4	16.9	2.1	16.6	3.2	1.1	
Propanal (aldehydes)	14	6.9	4.8	6.0	2.7	19	8.8	29	2.3	35	7.8	120	
Ethane	18	32	<5.0	<5.0	15	23	13	25	9.2	32	15	380	
Butane equivalents ^b	237	275	842	626	591	512	321	265	63	393	219	83	
Oxygen %					6%	5% ^c	0.8%	8.4%	7.6%	16.9%	5.7%	10.9%	7.0%

All components except oxygen were measured with FTIR spectroscopy. All values in ppm except oxygen which is in %.

^aThe results from Vessel #4 are means from measurements at four different levels of the stairway.

^bSum concentration of alkanes (C_nH_{2n+2}) with three or more carbons expressed as ppmv butane equivalents.

^cParallel reading from head space in cargo hold.

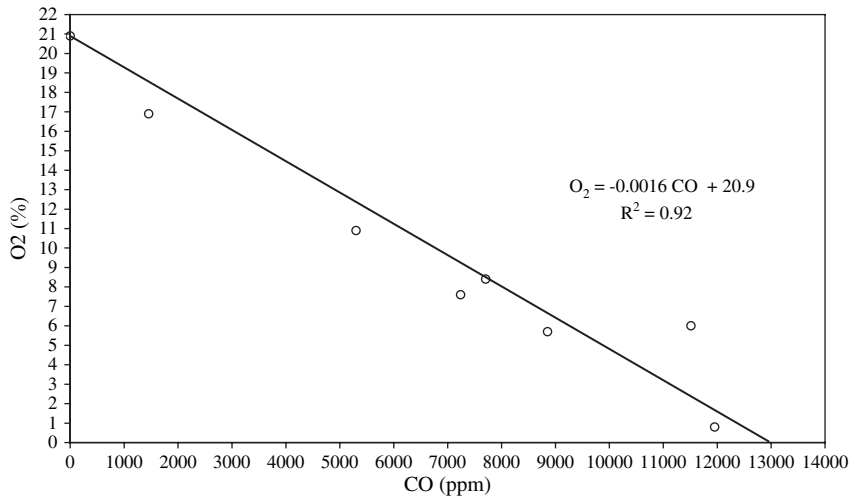


Fig. 2. The correlation between oxygen and CO concentrations in hatches and stairways. The point representing 20.9% oxygen and 0% CO is added manually.

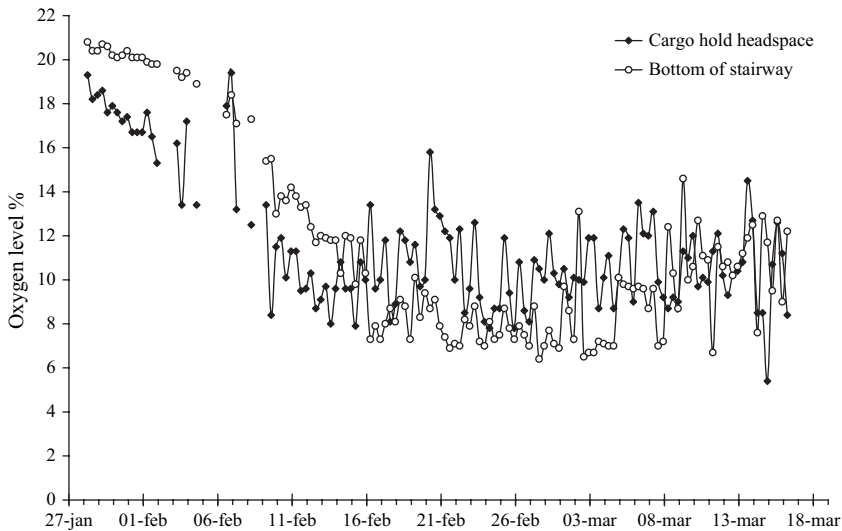


Fig. 3. The oxygen level in cargo hold headspace and bottom of stairway measured during ocean voyage (Vessel #4).

2007). A 10-min exposure at 1700 ppm or 30-min exposure at 600 ppm has been proposed as the airborne concentration of CO, above which it is predicted that the general population, including susceptible individuals, could experience life-threatening health effects or death (NAS/COT, 2005). This proposal assumes a normal oxygen level. With reference to Fig. 2, it is seen that a predicted CO level of 600 ppm is reached when the oxygen level is 19.9%, a condition reached after only 3 to 4 days at sea on Vessel #4.

Scientific information is readily available regarding the toxic effects of CO exposure and oxygen deficiency when studied separately. However, the information about any combined effects is very

sparse and appears to be limited to remarks about possible effects at higher altitudes (WHO, 1999). CO binds competitively to hemoglobin ~200 times more strongly than oxygen. It is likely that reduced oxygen partial pressure increases the available sites for CO binding and a toxic effect is caused more quickly and at lower CO concentrations. Physical activity will increase the uptake of CO. The US National Institute for Occupational Safety and Health defines an oxygen-deficient atmosphere as one with an oxygen partial pressure of <132 torr, equivalent to ~17.2% oxygen at sea level. Above this level, no physiological effects are expected as a result of oxygen deficiency. A minimum of 19.5% oxygen level is recommended for most work situations and

provides a margin of safety (ACGIH, 2007). This recommendation is only applicable if there are no other toxic gases present, such as CO.

Since no wood pellets were present and no corrosion was discovered in the stairways at discharge, which could have presented an alternative mechanism for oxygen depletion, it was obvious that gas moved quite freely between the cargo holds and the related stairways. The concentrations in the stairways were lower than in the cargo holds but still remained at very high levels. The results from one stairway showed that there was no stratification of concentrations; however, defective seals around doors may in other cases increase leakage and generate low levels at the top and toxic levels at the bottom of a stairway, creating a potential danger on entry. The difference in gas concentrations observed between the cargo holds on Vessel #5 is most probably an indication of such variation in gas leakage to ambient air, rather than any differences in emission rates.

The vessels' instruction manuals specified 2 h of self-ventilation prior to entry to the stairways. The slow decay of CO, which we recorded, shows that this is not sufficient. The vessels that arrived after the accident, introduced various methods to ventilate their stairways. From observation, it was clear that some crews were unaccustomed to the procedures and had difficulties due to the use of inappropriate, heavy and bulky equipment. The working space was frequently cramped, particularly when a ventilation hose was temporarily inserted and connected to a fan unit placed near the deck-access door.

Before entering the stairway, oxygen and CO were measured by the crew, by lowering a meter to the upper landing of the stairway. The lower landings could not be ventilated until it was deemed safe to enter the upper landing, whereupon a crew member was sent down with the ventilation equipment to proceed to the next level. In an unfortunate situation, pockets of toxic gases could be released into a previously cleared workspace. Understanding of the time required to clear the toxic gases was the subject of significant uncertainty among the crew as was the understanding that if a ventilated stairway is closed before the cargo of wood pellets is discharged it must be ventilated and monitored again before anyone enters it.

The combined observations indicate the need for the installations of well-designed, automatic, mechanical ventilation systems for the stairways. Such systems would significantly increase the safety of the workers and prevent loss of expensive time in port. The most appropriate type of ventilation for stairways is probably a balanced-type ventilation with mechanical supply and exhaust air, thus, limiting the risks of pressure differences in relation to the cargo holds. The second best solution is forcing air to the bottom level of the stairway thereby dis-

placing contaminated air to the top level and further to a free outside air space. Drawing air from the bottom of the stairways should be avoided since there is a risk that contaminated air will be drawn from the cargo holds. On some vessels, the stairway deck-access doors are located in semi-enclosed rooms. The release of stairway air into such a space might create a dangerous atmosphere.

A ventilation system should not be operated during the voyage in order to avoid the risk of oxygenation of the nearby cargo hold through leakage. Increased oxidation of the pellets may lead to an elevated temperature and uncontrolled thermal conditions in the cargo, particularly when passing through warmer tropical waters. The low oxygen content is in itself a safeguard against uncontrolled oxidation. A fire at sea would be a disastrous scenario and very difficult to control, similar to fires in silos.

Despite improved ventilation, it is important that both oxygen and CO are measured before entry into confined spaces in contact with wood pellets. Ideally, instrumentation should be calibrated for the oxygen and CO levels that might occur. If the calibration is made at a very different concentration than the level to be measured, it may lead to a potentially gross under- or over-estimation. However, instrumentation designed for use with high concentrations may be less accurate at low concentrations where clearance of workspaces is required. It may be difficult to find a single instrument that can accurately measure the whole range from 0 to 15 000 ppm CO. Given the circumstances, it is of primary importance that the measuring instruments are accurate at ~ 19.5% oxygen and at ~35 ppm CO. The performance of the instruments, such as recovery time and accuracy, after a shock exposure to extreme concentrations of CO should be specified by the manufacturers. To avoid shock exposure of the instruments, it is possible to use color indicator tubes designed for high CO levels, before checking with electrochemical and galvanic cell detectors.

A temporary and mobile workforce is characteristic of the shipping industry. New crew members must be effectively informed about the hazards associated with wood materials. The provision of a Shipper Cargo Information Sheet, which identifies the inherent hazards associated with the handling of wood pellets, is an important key to safe-guarding workers. It also appears that emergency crews attending accidents of this nature need to be better prepared in order to avoid exposure when entering the scene of an accident. The redesign of access doors would allow easier entry and exit procedures and provide better conditions during emergency rescue operations. It is very difficult to maneuver an unconscious person via vertical ladders and through narrow doors, particularly if the rescuer is wearing cylinders with breathing gas. Protective masks and filters are not effective

against CO and oxygen depletion, only self-contained breathing apparatuses will work.

An immediate and cost-effective safety precaution is to padlock and label all access doors to stairways and establish and enforce the strict entry procedures which are already stipulated in existing regulations. Leaving entry doors open for ventilation is an invitation for people to enter a toxic atmosphere. Door openings could be fitted with protective mesh, letting air out but preventing entry during ventilation. Warning signs placed on top of doors will be hidden when the door is open unless there is also a sign on the inside of such doors. Repeated safety training or a certification system for the personnel in question is recommended.

CONCLUSIONS

Ocean transportation of wood pellets in confined spaces may rapidly produce lethal levels of CO and an oxygen-deficient atmosphere that may leak into adjacent access spaces. This is the first report to recognize this danger. The oxygen depletion and CO formation are probably caused by oxidative degradation of natural lipids and other organic materials naturally present in wood pellets. The oxygen depletion may have a value in that it reduces the fire hazard associated with this cargo.

Measurement of both CO and oxygen levels is essential prior to entry into spaces with air communication with a cargo of wood pellets. Measurement of oxygen alone is not safe. Self-ventilation of stairways is not sufficient. Forced ventilation is necessary in or-

der to achieve safe entry conditions within a reasonable time. The provision of proper gas monitoring instruments and training and education of crews are of vital importance as well as the proper design, labeling and locking of access doors leading to confined spaces. The conclusions drawn here also apply generally to other confined spaces in contact with wood pellets.

REFERENCES

- ACGIH. (2007) TLVs and BEIs. Threshold limit values for chemical substances and physical agents. Biological exposure limits. Cincinnati: ACGIH.
- Arbetskyddsstyrelsen. (2005) AFS 2005:17 Hygieniska gränsvärden och åtgärder mot luftföroreningar. Solna: Arbetskyddsstyrelsen (In Swedish).
- Griffith D. (1996) Synthetic calibration and quantitative analysis of gas-phase FT-IR spectra. *App Spectrosc*; 50: 59–70.
- Melin S. (2007) Ocean transportation of pellets. *Cambio/IEA Conference*. Toronto, Canada.
- NAS/COT. (2005) Interim acute exposure guideline levels (AEGIs) carbon monoxide: National Advisory Committee for Acute Exposure Guideline Levels for Hazardous Substances. <http://www.epa.gov/oppt/aegl/pubs/tsd306.pdf>. February 2008.
- Rothman LS, Barbe A, Benner Chris D *et al.* (2003) The HITRAN molecular spectroscopic database: edition of 2000 including updates through 2001. *J Quant Spectrosc Radiat Transf*; 82: 5–44.
- Sharpe SW, Johnson TJ, Sams RL *et al.* (2004) Gas-phase databases for quantitative infrared spectroscopy. *App Spectrosc*; 58: 1452–61.
- Svedberg U, Högberg H-E, Högberg J *et al.* (2004) Emission of hexanal and carbon monoxide from storage of wood pellets, a potential occupational and domestic health hazard. *Ann Occup Hyg*; 48: 339–49.
- WHO. (1999) Environmental Health Criteria 213 Carbon Monoxide. Geneva: WHO.

**Department of Occupational and Environmental Medicine
Sundsvall Hospital
Sweden**

Toxic off-gassing and oxygen depletion during ocean transportation of pulp wood and wood chips

Interim report

Urban Svedberg¹

¹Department of Occupational and Environmental Medicine, Sundsvall Hospital, Sweden

Thursday, June 05, 2008

Introduction

We have recently reported about off-gassing of carbon monoxide and oxygen depletion in cargo holds and connecting spaces during shipment of wood pellets (Svedberg et al, 2008). The study was initiated after a fatal accident in Nov 2006 upon discharging wood pellets in the Port of Helsingborg, Sweden. The results showed that in 11 different holds and adjacent stairways on 5 different ships, an average CO-level of 8400 ± 3600 ppm. The CO₂-levels were $1 \pm 0.6\%$. The extreme CO concentrations was 14650 ppm and oxygen level of 0.8%.

Another fatal accident in May 2007, causing the death of two people during discharge of pulp wood in the Port of Timrå, Sweden, initiated the present study. Data collected by the rescue service showed 2.7% oxygen level in the stairways where the accident took place. The ship had been at sea for about 36 hours after finished loading. This latter accident brought the total number of deaths onboard vessels in Swedish ports under similar circumstances to seven within a two-year time span. Of the four remaining fatalities, one died while discharging pulp wood, one while discharging wood chips and two died when entering a cargo hold with rotten fish remains. The common characteristic of all accidents was that the victims had entered a non-ventilated stairway leading to the cargo hold. The rapid increase in international and national transportation of this types of cargoes apparently caught the shipping industry off-guard regarding workers' exposure to hazardous emissions and oxygen depletion.

The present study focuses on toxic gas emissions and oxygen depletion during ocean transportation of pulp wood and wood chips in bulk in confined cargo holds. The gases of particular interest are carbon dioxide (CO₂), carbon monoxide (CO) and hydrogen sulfide (H₂S) and the Lower Explosive Level (%LEL). As far as we know, there is no previous systematic investigation of these types emissions in the scientific literature or elsewhere made public.

Oxygen depletion in these cargoes is believed to be caused by either microbiological activity and/or autoxidation of wood constituents such as fatty acid and cellulose, hemi cellulose and lignin. CO₂ is primarily formed as result of microbiological activity but also autoxidative processes may produce some CO₂. CO is formed by a radical-induced oxidative degradation process of wood. Hydrogen sulfide is formed during anaerobic bacterial decomposition of sulfurous material in organic matter. Toxic levels of H₂S may form in confined spaces and accidents have been reported in the fishing industry (Nikkanen et al, 2004), farming (Gerasimon et al, 2007). The accidents happen when workers enter confined spaces. The information of the actual hydrogen sulfide exposure concentrations at the time of the accident is usually not reported. The simultaneous possible oxygen deficient atmosphere has not been reported although toxic synergistic effects may exist.

The aim of the present study was to investigate the gaseous compounds in the stairways leading into the cargo holds on vessels carrying pulp wood and wood chips.

Methods

35 shipments of wood and wood chips were investigated before discharge in various ports in northern Sweden between the months of May to January. The cargo was loaded in different ports around the Baltic Sea, mostly in the Baltic states of Estonia, Latvia and Lithuania but also ports in Sweden and Russia. The transportation time was usually in the 2-4 day range from finished loading to discharge. The investigated vessels had one or two cargo holds designed for bulk transportation. The design differed between ships. Adjacent stairways were leading down to each hold with an open access into the cargo hold at different levels. These openings were sometimes covered with boards during transport of wood chips to prevent wood chips to flow into the

stairway. On some ships the entrance doors to the stairways were located inside a confined room which first must be entered.

Wood chips were always transported in the holds while pulp wood was transported either in the holds or outside on top of the hatch covers. The wood species carried were pine, spruce, birch and aspen. Some had been stored for several years on land and some was fresh just weeks from the cutting. A few shipments were done with wood that had been stored in water for longer time.

Air samples were collected in the undisturbed air of the stairways leading into the cargo holds before the hold covers were removed. Measurements oxygen, carbon monoxide, hydrogen sulphide, and lower explosive level (LEL, expressed as % LEL of methane) were done with a direct reading portable multi-gas meter model RKI GX-2001 (Riken Keiki Co. Ltd, Tokyo, Japan). In addition to our own measurements, sampling was also systematically performed by one vessel crew, using the same method and type of instrument. The results of their measurements are also included in the results.

In order to study the chemical composition in more detail and to confirm the direct reading measurements, samples were also collected by pumping the air into Tedlar[®] sample bags which were analyzed within 24 hours using Fourier Transform Infrared Spectroscopy (FTIR).

The microbiological activity was investigated through speciation of the different types of microorganisms found on bark on two shipments.

Results

The results from the measurements are summarized in Table 1. The oxygen levels range from normal to complete depletion. The oxygen level shows an inversely correlation to the CO₂ level as described in Figure 1. In those cases where the oxygen level is zero the CO₂ level is 13-15% indicating that 60-70% of the oxygen is converted to CO₂. The high concentrations of CO₂ is a strong indications of the presence of biological activity.

The seasonal variation of the oxygen depletion is described in Figure 2. During the cold winter months the depletion is not as pronounced and zero readings were not obtained. The oxygen depletion was also seen to depend on the freshness of the cargo. Some cargoes had been stored on land for several years after a storm, and it was seen that the oxygen depletion was less.

The CO levels are generally below the acceptable 15-minute level of 100 ppm approved by the Swedish Occupational Hygiene standards (Arbetarskyddsstyrelsen, 2005). However, on three occasions this level was exceeded with at maximum reading of 322 ppm. On all of these occasions the oxygen level was below 3%, as can be seen in Figure 3.

The levels of hydrogen sulfide were found to be below the acceptable 15-minute exposure of 15 ppm according to the Swedish Occupational Hygiene standards. Again these instances occurred when the oxygen level was below 5%, as can be seen in Figure 4.

The %LEL levels were generally low except for birch wood where a maximum reading of 61 was recorded. It is however suspected that this is a misreading, and further monitoring of this type of cargo should be done.

The microbiological analysis of bark from two shipments of pine and spruce from March 11 showed presence of bacteria and fungi, i.e Aureobasidium, Cladosporium, Bacillus mycoides, Dematiaceous hypomycetes, Zygomycetes, Penicillium spp, Yeast. The bacteria total count (acridine orange stained biomass) was 1.3-2.8 x 10⁷/cm². These levels are high compared to

what is expected in a healthy human living environments, however may be just normal under these circumstances.

Discussion

The rapid depletion of oxygen, the high concentrations of CO₂ and the low CO levels compared to wood pellets, indicate a biochemical process rather than an oxidative degradation process which dominates in wood pellets. We postulate that the oxygen depletion and high CO₂ content in cargoes of pulp wood and wood chips is primarily caused by microbiological activity by the species found in the microbiological analysis of bark. The seasonal variation of oxygen depletion and CO₂ formation is believed to be caused by the temperature sensitivity among these microorganisms. It is therefore important to be careful particularly when entering confined spaces during the warm season, be aware of the seasonal changes and also of the dependence on the dryness of the cargo. Two separate shipments of apparently similar cargo may possess inherently different preconditions for oxygen depletion.

Severe oxygen depletion was present in all species of wood investigated. Both logs of pulp wood (roundwood) and wood chips caused similar depletion. The oxygen depletion is the most significant measure from a safety perspective. The conclusion is that if the oxygen level can be restored to a normal level, i.e. 20.9% there is no lingering risk from the remaining toxic gases. Based on the relationships between the oxygen content and CO and H₂S, as demonstrated in Figure 3 and Figure 4, a much lower oxygen level still would provide a large margin of safety toward toxic effects from these other gases, particularly when considering that the permissible 15-min values already has a margin of safety.

However, in the case of CO₂, the margin of safety is not very large as can be seen in Figure 1. By using the equation for the line of correlation, the permissible 15-min value of 1% CO₂ is reached when the oxygen level is as high as 19.5%. Although 1% CO₂ is not a dangerous level by itself, the combination effects with low oxygen content may constitute a hazard during prolonged stay in such an environment, particularly if the physical workload is heavy like climbing up and down stairways. The individual susceptibility to toxic gases can not be ignored.

All permissible exposure values assumes normal oxygen level. Possible combination effects is not accounted for. This is particularly the case of carbon monoxide which has an affinity for blood hemoglobin over 200 times that of oxygen, competing for the same sites. Hence, it is of outmost importance to measure both oxygen and carbon monoxide in cargoes with wood pellets, since the margin of safety by measuring oxygen alone, against high levels of CO is too narrow. However, in cargoes with wood chips and pulp wood it appears as if a normal measure of oxygen would provide sufficient margin of safety. Even a slightly decreased oxygen level ~20% would be acceptable for a shorter duration, and the determination of this limit may be a matter of policy rather than a safety issue itself. Appendix 7, § 6.2 of the Bulk Code specifies that 21% oxygen should be restored.

In the course of the investigations, it was seen that the same cargo hold could have widely different oxygen levels in the forward and aft section, i.e., the last measurement in Table 1. The reason behind these differences may be that leakage to the outside air is different in different parts of the hold, and that air migration is slower than the leakage. This is particularly the case when wood chips at times fill the stairways. The conclusion is that it is important to measure every entrance to the hold prior to entry.

Some ships have the location of the cargo stairway door entrances inside a separate room also considered a confined space with sealed doors to the outside, see Photo 1. In this particular room

there was a compressor installed which may cause crew to enter for its operation. This is a dangerous design since it may very well be believed that the room does not have air communication with the hold. The room had the same oxygen level (14%) as the hold itself.

Recommendations

Many of the recommendations related to wood chips and pulp wood are the same as those we already have suggested for wood pellets and for a comprehensive discussion we refer to that publication (Svedberg et al, 2008). The simple advice is to always adhere to the safe entry procedures. The oxygen level should always be measured before entering a confined space with air communication with a cargo hold with wood chips and pulp wood or timber (roundwood). An oxygen meter should always be worn when inside a confined space. Unventilated air pockets inside the confined space may exist. Some confined spaces may appear to be sealed towards the hold, however, experience has shown that such spaces most often share the air with the cargo through minute openings.

An important aspect is to seek effective preventive mechanism to avoid accidental entry into confined spaces. A cost-effective measure is to lock these entrance doors during voyage and keep the key with a responsible person until the safe entry permit procedures are underway. Access doors should be labeled on the outside and the inside with warning signs of low oxygen content, legible both when door is open and closed. Many times doors are opened for ventilation of the stairways and may thus be interpreted as an invitation to enter by an uninformed person. A chain or rope with a warning sign positioned across the door opening could prevent such accidental entry. Mechanical ventilation of stairways is preferred. Fresh air should be injected in the bottom of stairway thus displacing contaminated air to the outside. Drawing air from the bottom of the stairway may cause contaminated air to be drawn from the cargo holds.

The storage of tools or supplies inside confined spaces should be prohibited since accidents have occurred when crew have entered to collect these items.

References

Arbetskyddsstyrelsen. (2005) AFS 2005:17 Hygieniska gränsvärden och åtgärder mot luftföroreningar. Solna: Arbetskyddsstyrelsen 91-7930-458-3

Gerasimon G, Bennett S, Musser J, Rinard J.(2007) Acute hydrogen sulfide poisoning in a dairy farmer. Clin Toxicol (Phila); 45:420-3.

Nikkanen HE, Burns MM.(2004) Severe hydrogen sulfide exposure in a working adolescent. Pediatrics; 113:927-9.

Svedberg U, Samuelsson J, Melin S.(2008) Hazardous off-gassing of carbon monoxide and oxygen depletion during ocean transport of wood pellets. Ann Occup Hyg; 52:259-266.
<http://annhyg.oxfordjournals.org/cgi/content/abstract/men013>

Table 1 Summary of all measurements sorted in order of date of discharge

Date	ID#	Hold	Species	Type	CO ₂ %	O ₂ %	H ₂ S ppm	CO ppm	% LEL
2007-06-18	1	1	Pine or Spruce	Chips	3,0	7,0		8,1	13
2007-06-18	1	2	Pine or Spruce	Chips					
2007-07-05	7	1	Birch	Logs		0	0	18	0
2007-07-05	7	2	Birch	Logs		0	0	15	0
2007-07-11	8	1	Pine or Spruce	Logs		0	13,5	295	9
2007-07-11	8	2	Pine or Spruce	Logs		3	19	322	7
2007-07-19	9	1	Pine or Spruce	Logs		0	0	17	9
2007-07-19	9	2	Pine or Spruce	Logs		0	0	15	0
2007-07-26	10	1	Pine or Spruce	Logs		0	6,5	84	8,5
2007-07-26	10	2	Pine or Spruce	Logs		0	5,5	86	8
2007-08-11	11	1	Pine or Spruce	Logs		6,4	0	0	6
2007-08-11	11	2	Pine or Spruce	Logs		0	4,5	67	9
2007-08-15	2	1	Pine or Spruce	Chips	15,2	0,9		10,5	0
2007-08-15	2	2	Pine or Spruce	Chips					
2007-08-17	3	1	Pine or Spruce	Logs	4,3	16,0		54,9	0
2007-08-17	3	2	Pine or Spruce	Logs	0,8	19,0		9,7	0
2007-08-23	4	1	Pine or Spruce	Logs		19,9		30	6
2007-08-23	4	2	Pine or Spruce	Logs	2,8	18,9		19,7	0
2007-08-27	5	1	Pine or Spruce	Logs	15,3	0		12,6	1
2007-08-27	5	2	Pine or Spruce	Logs	13,2	0		29,5	10
2007-08-27	12	1	Birch	Logs		0	2,5	47	10
2007-08-27	12	2	Birch	Logs		4,5	4	41	4
2007-09-12	13	1	Pine or Spruce	Chips		1,3	6	163	8
2007-09-12	13	2	Pine or Spruce	Chips		2,5	1	40	7
2007-09-26	14	1	Pine or Spruce	Logs		17	0	0	0
2007-09-26	14	2	Pine or Spruce	Logs		20,9	0	0	0
2007-09-29	6	1	Pine or Spruce	Chips	8,3	12,0		6,1	
2007-09-29	6	2	Pine or Spruce	Chips	4,9	16,6		3,9	0
2007-10-02	15	1	Pine or Spruce	Logs		17,4	0	0	0
2007-10-02	15	2	Pine or Spruce	Logs		17,4	0	0	0
2007-10-09	16	1	Aspen/Birch	Logs		1,2	5	98	22
2007-10-09	16	2	Aspen/Birch	Logs		9,1	0	2,5	28
2007-10-14	17	1	Birch	Logs		8,8	0	0	3
2007-10-14	17	2	Birch	Logs		10,9	0	0	2
2007-10-30	18	1	Pine or Spruce	Chips		8,3			
2007-10-30	18	2	Pine or Spruce	Chips		9,4			
2007-11-15	20	1	Pine or Spruce	Logs		20,9	0	0	0
2007-11-15	20	2	Pine or Spruce	Logs		20,9	0	0	0
2007-11-22	21	1	Birch	Logs		8,8	0	0	3
2007-11-22	21	2	Birch	Logs		10,9	0	0	2
2007-11-30	22	1	Birch	Logs		20,9	0	0	0
2007-11-30	22	2	Birch	Logs		18,7	0	0	0
2007-12-07	23	1	Birch	Logs		17,9	0	0	0
2007-12-07	23	2	Birch	Logs		18,7	0	0	0
2007-12-12	24	1	?	Logs		12,7	0	0	0
2007-12-12	24	2	?	Logs		14,1	0	0	0
2007-12-20	25	1	Aspen	Logs		14,8	0	56	10
2007-12-20	25	2	Aspen	Logs		15,2	0	48	12
2007-12-28	26	1	Birch	Logs		17,3	0	0	0
2007-12-28	26	2	Birch	Logs		19,2	0	0	61

2008-01-09	27	1	Birch	Logs		15,5	0	0	3
2008-01-09	27	2	Birch	Logs		15	0	0	4
2008-01-15	28	1	Birch	Logs		12,1	0	54	13
2008-01-15	28	2	Birch	Logs		14,1	0	60	14
2008-01-29	29	1	Pine or Spruce	Logs		6,9			
2008-01-29	29	2	Pine or Spruce	Logs		9,8			
2008-03-10	30	1	Pine or Spruce	Logs		19,2	0	11	0
2008-03-10	30	2	Pine or Spruce	Logs					
2008-03-11	31	1	Pine or Spruce	Logs		14,2	0	11	0
2008-03-11	31	2	Pine or Spruce	Logs		13,5	0	37	0
2008-04-03	32	1	Pine or Spruce	Logs		18,5	0	18	0
2008-04-03	32	2	Pine or Spruce	Logs		18,4	0	15	0
2008-05-06	33	1	Pine or Spruce	Logs		18,3			
2008-05-19	34	1	Pine or Spruce	Logs		14,9	0	22	0
2008-05-19	34	2	Pine or Spruce	Logs		3,8	0,5	62	6
2008-05-22	35	1	Pine or Spruce	Logs		14,1	0	20	0
2008-05-27	36	1 FWD	Pine or Spruce	Chips		0,3	14	34	13
2008-05-27	36	1 Aft	Pine or Spruce	Chips		10	16	82	16

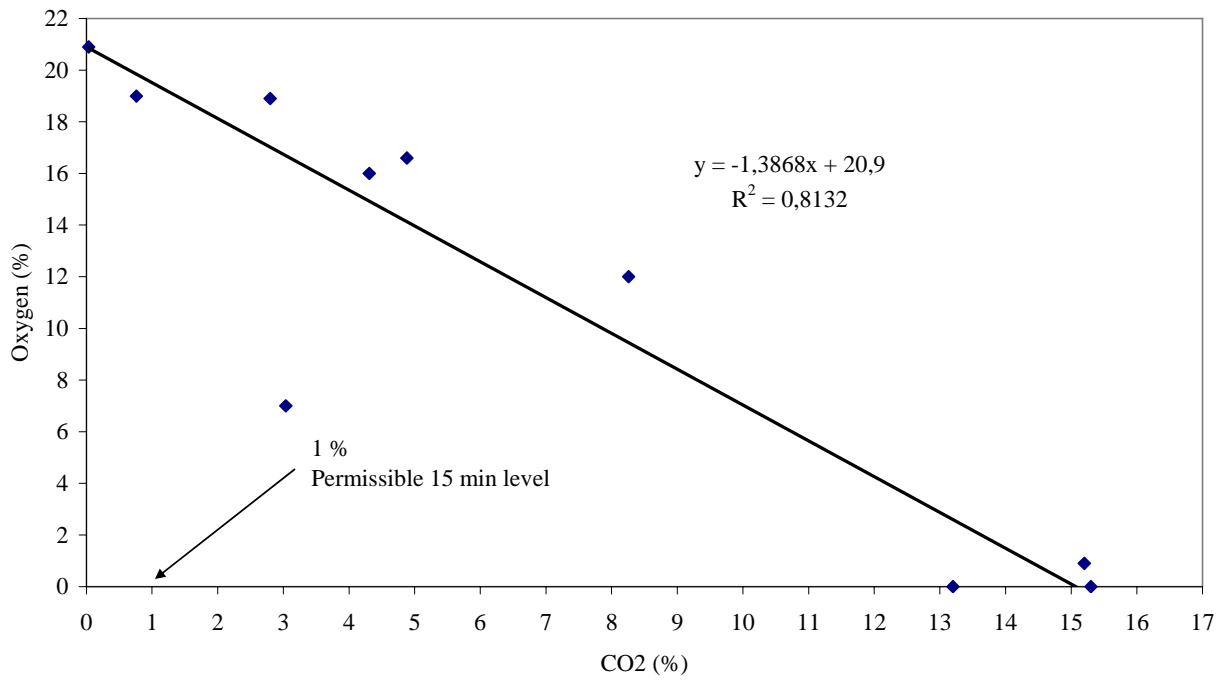


Figure 1. Oxygen content as a function of the CO2 level.

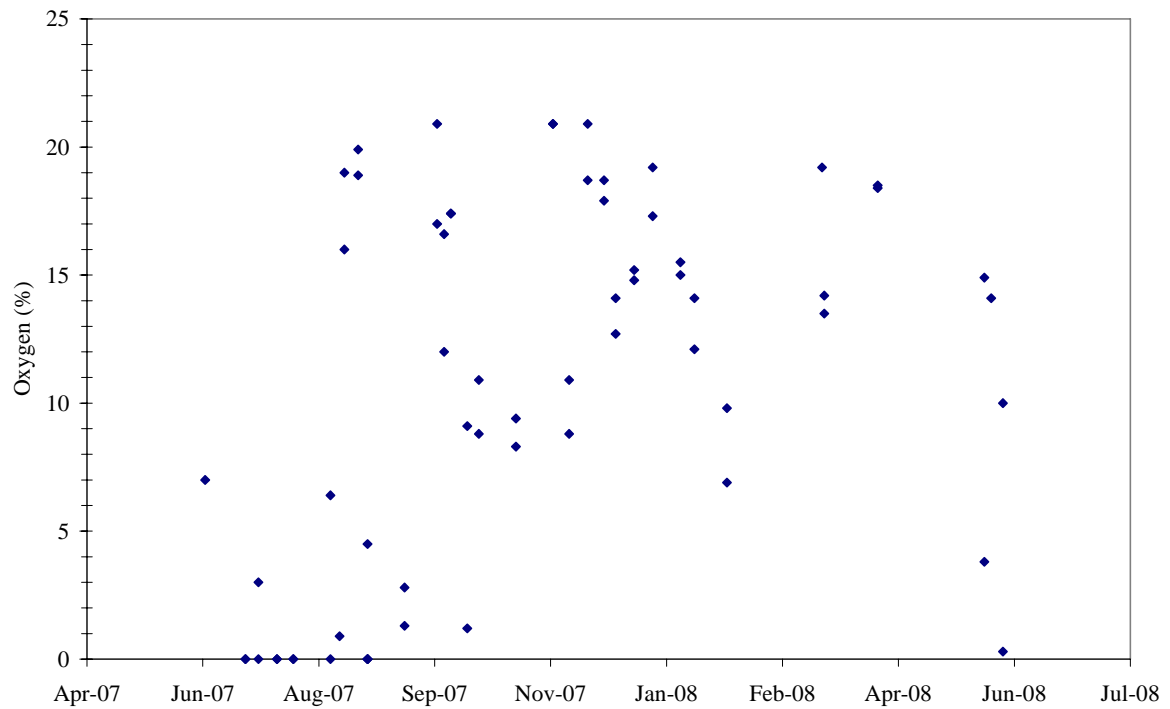


Figure 2. The seasonal variation of the final oxygen level in all sample positions on the investigated ships.

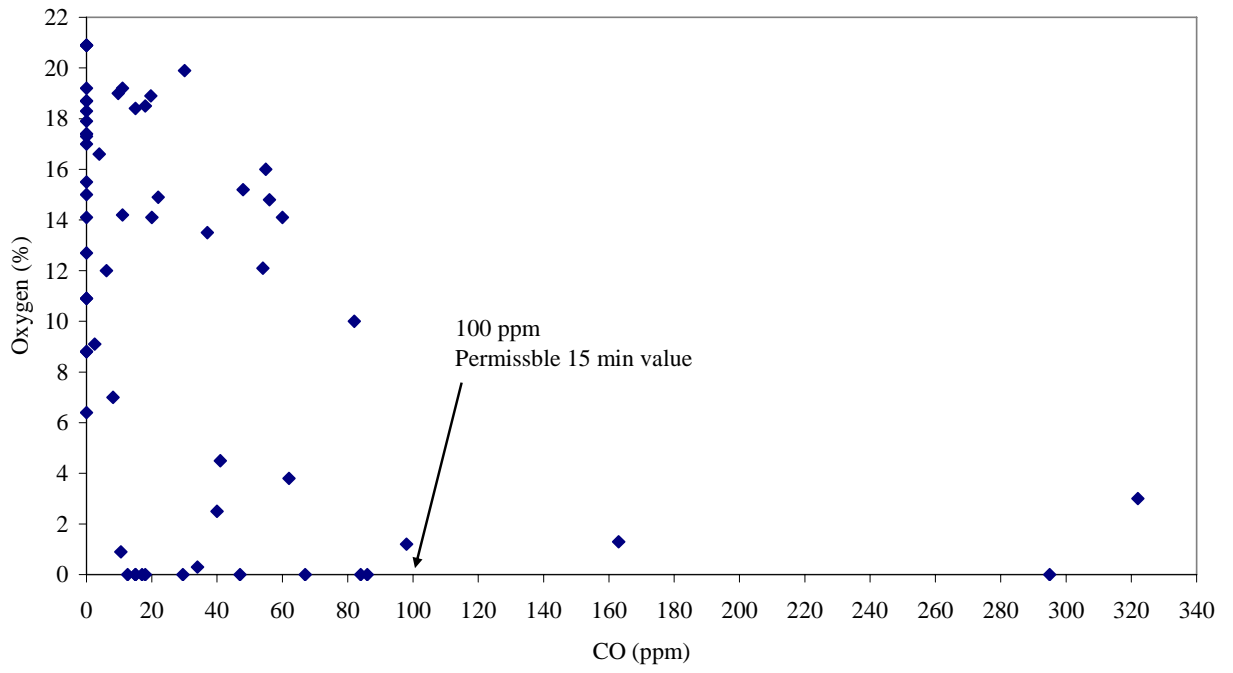


Figure 3. Oxygen vs CO content

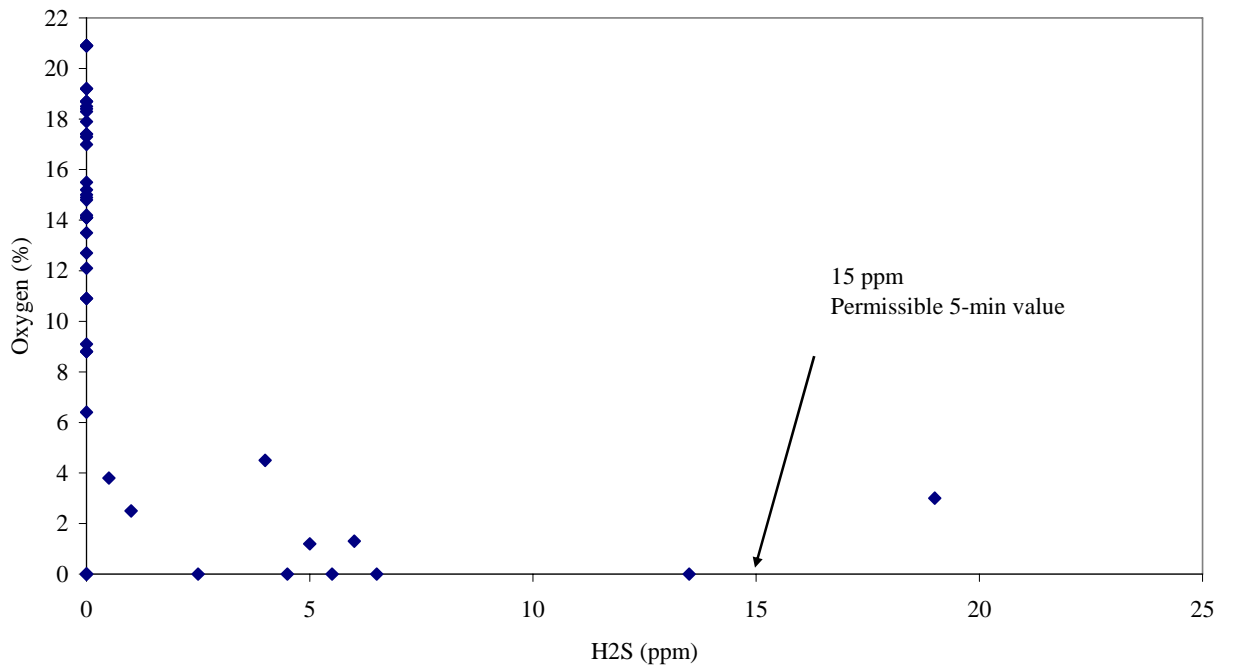


Figure 4. Oxygen vs. hydrogen sulfide

Photos



Photo 1. Confined entrance room with operating panels. The hold entrance door can be seen as the dark green box in the centre of picture